

**Flood Control Project Maintenance
Levee Inspections****LMA District Cover Sheet****Spring 2015 Levee Inspection Results****Reclamation District No. 2068 Yolano**

	Spring (March - May)	Summer ** (June - August)	Fall (September - November)	Winter ** (December - February)
* Overall LMA Rating (Fall Only)				

** Non-receipt of Summer or Winter Inspection Reports may effect overall annual rating.

*
SPRING INSPECTIONS: Overall maintenance ratings are not determined for the spring inspection results. Individual maintenance deficiencies are rated using the same criteria in the spring and in the fall.

FALL INSPECTIONS: The overall maintenance rating shown above is based on operation and maintenance deficiencies identified within the attached unit inspection reports. This rating is not intended to be an indication of risk.

Comments

**Flood Control Project Maintenance
Levee Inspections**

Unit Cover Sheet

Spring 2015 Levee Inspection Results

Reclamation District No. 2068 Yolo

Waterway			Bank	Unit Miles
Unit No. 01 Yolo Bypass			Right	5.48
	Spring (March - May)	Summer (June - August)	(September - November) Fall	Winter (December - February)
Unit Maintenance Rating (Fall Only)				
Date of Inspection	05/14/2015 - 05/14/2015			
DWR Inspector	Herman Phillips			
Accompanied By				

Summer & Winter Inspections

The Local Maintaining Agency (LMA) is responsible for summer and winter inspections. The LMA is required to submit a report regarding summer and winter inspections to the California Department of Water Resources (DWR).

DWR must be informed on the:

- a) completion of the inspection
- b) any changes other than the results of normal maintenance
- c) corrections to deficiencies noted in this report

If additional items are noted, further documentation of those items must also be submitted.

The LMA should submit this information to DWR using the LMA web application tool available at:

<http://cdec.water.ca.gov/lma.html>

If the LMA is unable to submit information on this webpage, please contact DWR for assistance.

The LMA should submit the information and any associated documentation by September 30 for summer inspections and March 31 for winter inspections.

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2015

Reclamation District No. 2068 Yolano

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Yolo Bypass	Right	5.48	05/14/2015 05/14/2015	Herman Phillips

LM Start		Rating **	A	Issue No.	3
LM End		Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Operations & Maintenance Manuals				°
					°
DWR ID	DWR_RD2068_01_f_2014_3				
Action/Comments					
Inspector Comments: RD 2068 has the O&M Manual on hand.					

No Photos

LM Start		Rating **	A	Issue No.	4	
LM End		Issue Type +	Ma	Location *	LS	
Category	Earthen Levee			GPS Latitude/Longitude		
				Start		End
Item	Flood Preparedness & Training				°	°
					°	°
DWR ID	DWR_RD2068_01_f_2014_4					
Action/Comments						
Inspector Comments: RD 2068 crew members are trained yearly.						

No Photos

LM Start		Rating **	A	Issue No.	5	
LM End		Issue Type +	Ma	Location *	LS	
Category	Earthen Levee			GPS Latitude/Longitude		
				Start		End
Item	Emergency Supplies & Equipment				°	°
					°	°
DWR ID	DWR_RD2068_01_f_2014_5					
Action/Comments						
Inspector Comments: RD 2068 has emergency supplies stored.						

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2015

Reclamation District No. 2068 Yolano

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Yolo Bypass	Right	5.48	05/14/2015 05/14/2015	Herman Phillips

LM Start	0.00	Rating **	A	Issue No.	16
LM End	0.00	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.402836 °	38.402836 °
				-121.693780 °	-121.693780 °
DWR ID	DWR_RD2068_01_s _ 2015_16				
Action/Comments					
Control annual grass and weeds on the levee slopes and easements.					

Photo 1 of 1 : SP_2015_RD2068_193_16_20150604_00001.jpg



View looking downstream at the landside slope.

LM Start	0.49	Rating **	M	Issue No.	17
LM End	0.49	Issue Type +	En	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP Field Study			38.401440 °	38.401440 °
				-121.693750 °	-121.693750 °
DWR ID					
Action/Comments					
Inspector Comments: FS_ID:17445 DS_ID:19331 EP_NO: N/A Repair Type: Non-Urgent Crossing Status: Not Found UCIP Comments: Pipe ends covered in soil. May be abandoned and if so it should be done properly. FIELD_STRUCT_DESC: 14-inch corrugated metal pipe through the level 6.6 feet below the crown. Flap gates on both ends. Pipe ends covered by dirt (O&M, 1962). FS Date: 08/08/2013					

No Photos

LM Start	0.55	Rating **	M	Issue No.	9
LM End	0.66	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.400553 °	38.399037 °
				-121.693818 °	-121.693820 °
DWR ID	DWR_RD2068_01_s _ 2015_9				
Action/Comments					
Control annual grass and weeds on the levee slopes and easements.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2015

Reclamation District No. 2068 Yolano

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Yolo Bypass	Right	5.48	05/14/2015 05/14/2015	Herman Phillips

LM Start	0.55	Rating **	A	Issue No.	10
LM End	2.00	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.400553 °	38.379532 °
				-121.693818 °	-121.693910 °
DWR ID	DWR_RD2068_01_s_2015_10				
Action/Comments					
Control annual grass and weeds on the levee slopes and easements.					

No Photos

LM Start	2.00	Rating **	M	Issue No.	18
LM End	2.00	Issue Type +	En	Location *	WS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP Field Study			38.379660 °	38.379660 °
				-121.693870 °	-121.693870 °
DWR ID					
Action/Comments					
Inspector Comments: FS_ID:17545 DS_ID:19334 EP_NO: 12389 Repair Type: Non-Urgent Crossing Status: Not Found UCIP Comments: Need to determine disposition of pipe with PG&E. FIELD_STRUCT_DESC: 6-inch gas line through the levee 4 feet below the crown (Permit No. 12389, 1978). FS Date: 08/08/2013					

No Photos

LM Start	2.00	Rating **	M	Issue No.	19
LM End	2.00	Issue Type +	En	Location *	WS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP Field Study			38.379560 °	38.379560 °
				-121.693870 °	-121.693870 °
DWR ID					
Action/Comments					
Inspector Comments: FS_ID:17547 DS_ID:19345 EP_NO: 7260 Repair Type: Non-Urgent Crossing Status: Not Found UCIP Comments: Need to determine disposition of pipe with PG&E. FIELD_STRUCT_DESC: 2 of 2: 4-inch gas line through the levee 2 feet below the crown (Permit No. 7260, 1974). FS Date: 08/08/2013					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	---	--	---	--

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2015

Reclamation District No. 2068 Yolo

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Yolo Bypass	Right	5.48	05/14/2015 05/14/2015	Herman Phillips

LM Start	2.49	Rating **	M	Issue No.	20
LM End	2.49	Issue Type +	En	Location *	WS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP Field Study			38.372547 °	38.372547 °
				-121.693956 °	-121.693956 °
DWR ID					
Action/Comments					
Inspector Comments: FS_ID:17548 DS_ID:19329 EP_NO: 13028 Repair Type: Non-Urgent Crossing Status: Not Found UCIP Comments: Need to determine disposition of pipe. FIELD_STRUCT_DESC: 10-inch steel pipe through the level 2 feet below the crown. A 4-inch gas line is sleeved through the 10-inch pipe. (Permit No. 13028, 1981). FS Date: 08/08/2013					

No Photos

LM Start	2.53	Rating **	M	Issue No.	11
LM End	2.91	Issue Type +	Ma	Location *	CR
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.371892 °	38.366373 °
				-121.693955 °	-121.693965 °
DWR ID	DWR_RD2068_01_s_2015_11				
Action/Comments					
Keep the crown roadway free of vegetation.					

No Photos

LM Start	2.65	Rating **	M	Issue No.	12
LM End	3.08	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.370107 °	38.363848 °
				-121.693952 °	-121.694027 °
DWR ID	DWR_RD2068_01_s_2015_12				
Action/Comments					
Control annual grass and weeds on the levee slopes and easements.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	---	--	---	--

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2015

Reclamation District No. 2068 Yolo

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Yolo Bypass	Right	5.48	05/14/2015 05/14/2015	Herman Phillips

LM Start	2.66	Rating **	M	Issue No.	13
LM End	3.01	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.370032 °	38.364957 °
				-121.693960 °	-121.694028 °
DWR ID	DWR_RD2068_01_s _ 2015_13				
Action/Comments					
Control annual grass and weeds on the levee slopes and easements.					

No Photos

LM Start	3.36	Rating **	M	Issue No.	14
LM End	4.58	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.359818 °	38.342140 °
				-121.694055 °	-121.693925 °
DWR ID	DWR_RD2068_01_s _ 2015_14				
Action/Comments					
Control annual grass and weeds on the levee slopes and easements.					

No Photos

LM Start	3.50	Rating **	U	Issue No.	21
LM End	3.50	Issue Type +	En	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP Field Study			38.358040 °	38.358040 °
				-121.694040 °	-121.694040 °
DWR ID					
Action/Comments					
Inspector Comments: FS_ID:41840 DS_ID:19335 EP_NO: 7220 Repair Type: Urgent Crossing Status: Indicator Found UCIP Comments: Pipe needs to have markers installed on both sides of levee. FIELD_STRUCT_DESC: 6.625-inch gas line through the levee 3 feet below the crown (Permit No. 7220, 1971). FS Date: 08/08/2013					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---

**Flood Control Project Maintenance
Levee Inspections**

Unit Cover Sheet

Spring 2015 Levee Inspection Results

Reclamation District No. 2068 Yolano

Waterway			Bank	Unit Miles
Unit No. 02 Back Levee			Left	3.22
	Spring (March - May)	Summer (June - August)	(September - November) Fall	Winter (December - February)
Unit Maintenance Rating (Fall Only)				
Date of Inspection	05/14/2015 - 05/14/2015			
DWR Inspector	Herman Phillips			
Accompanied By				

Summer & Winter Inspections

The Local Maintaining Agency (LMA) is responsible for summer and winter inspections. The LMA is required to submit a report regarding summer and winter inspections to the California Department of Water Resources (DWR).

DWR must be informed on the:

- a) completion of the inspection
- b) any changes other than the results of normal maintenance
- c) corrections to deficiencies noted in this report

If additional items are noted, further documentation of those items must also be submitted.

The LMA should submit this information to DWR using the LMA web application tool available at:

<http://cdec.water.ca.gov/lma.html>

If the LMA is unable to submit information on this webpage, please contact DWR for assistance.

The LMA should submit the information and any associated documentation by September 30 for summer inspections and March 31 for winter inspections.

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2015

Reclamation District No. 2068 Yolano

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Back Levee	Left	3.22	05/14/2015 05/14/2015	Herman Phillips

LM Start	0.00	Rating **	M	Issue No.	16
LM End	0.00	Issue Type +	En	Location *	CR
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP Field Study			38.358250 °	38.358250 °
				-121.740377 °	-121.740377 °
DWR ID					
Action/Comments					
Inspector Comments: FS_ID:17505 DS_ID:19353 EP_NO: 13490 Repair Type: Non-Urgent Crossing Status: Not Found UCIP Comments: Appears abandoned. Need to verify pipe status with PG&E. FIELD_STRUCT_DESC: 4-inch steel gas pipeline through the levee 3.5 feet below the crown (Permit No. 13490, 1982). FS Date: 08/08/2013					

No Photos

LM Start	0.05	Rating **	M	Issue No.	9
LM End	0.46	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.358823 °	38.364873 °
				-121.740405 °	-121.740298 °
DWR ID	DWR_RD2068_02_s_2015_9				
Action/Comments					
Control annual grass and weeds on the levee slopes and easements.					

Photo 1 of 1 : SP_2015_RD2068_194_9_20150604_00004.jpg



View looking downstream at the levee section.

LM Start	0.09	Rating **	M	Issue No.	10
LM End	0.46	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.359427 °	38.364865 °
				-121.740385 °	-121.740300 °
DWR ID	DWR_RD2068_02_s_2015_10				
Action/Comments					
Remove the wild growth other than native grasses from the levee slopes.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	---	--	---	--

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2015

Reclamation District No. 2068 Yolano

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Back Levee	Left	3.22	05/14/2015 05/14/2015	Herman Phillips

LM Start	0.46	Rating **	A	Issue No.	12
LM End	1.86	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.364865 °	38.382680 °
				-121.740300 °	-121.730165 °
DWR ID	DWR_RD2068_02_s _ 2015_12				
Action/Comments					
Control annual grass and weeds on the levee slopes and easements.					

No Photos

LM Start	0.46	Rating **	A	Issue No.	11
LM End	1.86	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.364865 °	38.382695 °
				-121.740300 °	-121.730150 °
DWR ID	DWR_RD2068_02_s _ 2015_11				
Action/Comments					
Control annual grass and weeds on the levee slopes and easements.					

No Photos

LM Start	0.83	Rating **	M	Issue No.	17
LM End	0.83	Issue Type +	En	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP Field Study			38.370205 °	38.370205 °
				-121.740170 °	-121.740170 °
DWR ID					
Action/Comments					
Inspector Comments: FS_ID:41560					
DS_ID:19346					
EP_NO: N/A					
Repair Type: Non-Urgent					
Crossing Status: Not Found					
UCIP Comments: No pipe found. Verify abandonment with RD 2068.					
FIELD_STRUCT_DESC: 24-inch pipe through the levee 9.0 feet below crown. No control valves. Cannot be located. Originally included in O&M manual, 1962.					
FS Date: 08/08/2013					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	---	--	---	--

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2015

Reclamation District No. 2068 Yolano

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Back Levee	Left	3.22	05/14/2015 05/14/2015	Herman Phillips

LM Start	0.85	Rating **	M	Issue No.	18
LM End	0.85	Issue Type +	En	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP Field Study			38.370422 °	38.370422 °
				-121.740163 °	-121.740163 °
DWR ID					
Action/Comments					
Inspector Comments: FS_ID:17507 DS_ID:19358 EP_NO: N/A Repair Type: Non-Urgent Crossing Status: Not Found UCIP Comments: Verify abandonment with RD 2068. FIELD_STRUCT_DESC: *Abandoned* 18-inch steel irrigation pipe through the levee 7.5 feet below the crown. Slidegate in concrete distribution box on both ends (O&M, 1962). Removed under Permit No. 9762, FS Date: 08/08/2013					

No Photos

LM Start	0.85	Rating **	M	Issue No.	19
LM End	0.85	Issue Type +	En	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP Field Study			38.370556 °	38.370556 °
				-121.740159 °	-121.740159 °
DWR ID					
Action/Comments					
Inspector Comments: FS_ID:21052					
DS_ID:19359					
EP_NO: N/A					
Repair Type: Non-Urgent					
Crossing Status: Not Found					
UCIP Comments: Verify abandonment of pipe with RD 2068.					
FIELD_STRUCT_DESC: *REMOVED* Unknown size irrigation pipe					
through the levee at an unknown depth below the crown.					
FS Date: 08/08/2013					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
---	--	--	--	--	--

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2015

Reclamation District No. 2068 Yolano

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Back Levee	Left	3.22	05/14/2015 05/14/2015	Herman Phillips

LM Start	0.87	Rating **	M	Issue No.	20
LM End	0.87	Issue Type +	En	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP Field Study			38.370783 °	38.370783 °
				-121.740152 °	-121.740152 °
DWR ID					
Action/Comments					
Inspector Comments: FS_ID:21053 DS_ID:19347 EP_NO: 10164 Repair Type: Non-Urgent Crossing Status: Not Found UCIP Comments: Verify abandonment with RD 2068. FIELD_STRUCT_DESC: 1 of 6: 30-inch corrugated metal pipe through the levee 10.2 feet below the crown (ABO No. 10164, 1974). Originally included in the O&M manual, 1962. FS Date: 08/08/2013					

No Photos

LM Start	0.90	Rating **	M	Issue No.	21
LM End	0.90	Issue Type +	En	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP Field Study			38.371273 °	38.371273 °
				-121.740138 °	-121.740138 °
DWR ID					
Action/Comments					
Inspector Comments: FS_ID:17531 DS_ID:19355 EP_NO: 8151 Repair Type: Non-Urgent Crossing Status: Indicator Found UCIP Comments: Appears abandoned. Need to verify with pipeline owner. FIELD_STRUCT_DESC: 8-inch steel gas pipe through the levee 3 feet below the crown (Permit No. 8151, 1972). Gasline markers visible on east toe of levee at intersection of levee and Delhi road. FS Date: 08/08/2013					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
---	--	--	--	--	--

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2015

Reclamation District No. 2068 Yolano

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Back Levee	Left	3.22	05/14/2015 05/14/2015	Herman Phillips

LM Start	1.07	Rating **	M	Issue No.	22
LM End	1.07	Issue Type +	En	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP Field Study			38.373330 °	38.373330 °
				-121.738530 °	-121.738530 °
DWR ID					
Action/Comments					
Inspector Comments: FS_ID:17532 DS_ID:19354 EP_NO: 13028 Repair Type: Non-Urgent Crossing Status: Indicator Found UCIP Comments: Need improved signage on LS and WS shoulders. FIELD_STRUCT_DESC: 10-inch steel pipe through the levee 2 feet below the crown. A 4-inch gas line is sleeved through the 10-inch pipe. Sign missing from marker post on east slope. 2-inch vent pipe with identification sign located off west bank of levee and off toe of east side of levee at fence (Permit No. 13028, 1981). FS Date: 08/13/2013					

No Photos

LM Start	1.97	Rating **	M	Issue No.	13
LM End	3.14	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.384003 °	38.397820 °
				-121.728983 °	-121.716613 °
DWR ID	DWR_RD2068_02_s_2015_13				
Action/Comments					
Control annual grass and weeds on the levee slopes and easements.					

No Photos

LM Start	1.99	Rating **	M	Issue No.	14
LM End	3.13	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.384177 °	38.397702 °
				-121.728827 °	-121.716702 °
DWR ID	DWR_RD2068_02_s_2015_14				
Action/Comments					
Control annual grass and weeds on the levee slopes and easements.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	---	--	---	--

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2015

Reclamation District No. 2068 Yolano

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Back Levee	Left	3.22	05/14/2015 05/14/2015	Herman Phillips

LM Start	1.99	Rating **	M	Issue No.	15
LM End	3.11	Issue Type +	Ma	Location *	CR
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.384228 °	38.397437 °
				-121.728793 °	-121.716908 °
DWR ID	DWR_RD2068_02_s _ 2015_15				
Action/Comments					
Keep the crown roadway free of vegetation.					

No Photos

LM Start	2.82	Rating **	M	Issue No.	23
LM End	2.82	Issue Type +	En	Location *	CR
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP Field Study			38.393943 °	38.393943 °
				-121.719991 °	-121.719991 °
DWR ID					
Action/Comments					
Inspector Comments: FS_ID:17538					
DS_ID:19350					
EP_NO: 1195					
Repair Type: Non-Urgent					
Crossing Status: Not Found					
UCIP Comments: Need to determine disposition of gas line.					
FIELD_STRUCT_DESC: 10.75-inch steel gas pipe through the levee 2 feet below the crown (Permit No. 1195, 1947).					
FS Date: 08/13/2013					

No Photos

LM Start	3.16	Rating **	M	Issue No.	24
LM End	3.16	Issue Type +	En	Location *	CR
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP Field Study			38.397933 °	38.397933 °
				-121.716406 °	-121.716406 °
DWR ID					
Action/Comments					
Inspector Comments: FS_ID:42725 DS_ID:19352 EP_NO: 10164 Repair Type: Non-Urgent Crossing Status: Found UCIP Comments: Appears abandoned and if so should be done properly. Pipe buried except for small opening. FIELD_STRUCT_DESC: 6 of 6: 48-inch corrugated metal pipe through the levee 4.0 feet below the crown (ABO No. 10164, 1974). Originally included in the O&M manual, 1962. FS Date: 08/13/2013					

No Photos

* Location		** Rating		+ Issue Type	
LS : Land Side	N/A : Not Applicable	A : Acceptable	N : Not Inspected/Rated	Ma : Maintenance Deficiency	
WS : Water Side		M : Minimally Acceptable	C : Corrected	Ob : Design & System Obsolescence	
CR : Crown		U : Unacceptable	A/W : Acceptable but Monitor & Maintain	En : Enforcement	